

## Release Notes

**Product Name:** VS-6464DN-EM

**Current Version:**

Type	Number	Date
Firmware	6.6_0001	August 2023
Software	–	–
Web	–	–
Hardware	–	–

**RN Date:** August 17, 2023

**Reference:** 18989

### Kramer Product Affected:

Product Name	Minimum FW Version for Upgrade	Recommended for All Units	Only if Added Features are Required
VS-6464DN-EM	Any	Yes	Yes

### Summary:

- Added feature(s).

### Codependency with Other Products and Software:

- There is no codependency with other products or software.



**KRAMER ELECTRONICS, Ltd.**

E-mail: [info@kramerav.com](mailto:info@kramerav.com)

Web: [www.kramerav.com](http://www.kramerav.com)

## Release Notes

**Product Name:** VS-6464DN-EM

**Current Version:**

Type	Number	Date
Firmware	6.6_0001	August 2023
Software	–	–
Web	–	–
Hardware	–	–

**RN Date:** August 17, 2023

**Reference:** 18989

### New Features:

ID	New Feature Description
3024	Security enhancement.

### Bugs to Fix in Future Versions:

ID	Deferred Bug Description
5216	OUT-LOAD menu: a circle is displayed at VGA Cards and SDI Cards outputs even though they are not connected to monitors.
11117	On F610-OUT4-F32 card P3K command HDCP-STAT? always returns "0". Should return Error.
12344	Configuring Default Setup via the front panel button requires two presses in order to proceed to Take button press.
12392	VS-6464DN-EM test card: Pattern generator Test card: Once after placing or removing jumper B19 for resolutions range extension, need also DIP switch toggle for B19 change to take effect.
14219	Rarely, Factory Default command may result in Keyboard operation freeze. Workaround: Power cycle the device.
16237	WEB - DGKat-OUT8-F64 - The LEDs are light green although the cable was disconnected from the card
16244	WEB - Copying an EDID (Input or Output) to All fails, Network Error is displayed, and the process is halted
16255	WEB - DGKAT OUT8 - F64 - EDID – Device must be rebooted in order to see the correct short summary of the EDID.
16263	WEB - DGKAT-OUT8-F64 - HDCP status is none although the source sends encrypted signal.
17126	WEB - The device copies corrupt edid - epson-eb-1000u_2_Blocks_Zeroes_In_Block_1



**KRAMER ELECTRONICS, Ltd.**

E-mail: [info@kramerav.com](mailto:info@kramerav.com)

Web: [www.kramerav.com](http://www.kramerav.com)

## Release Notes

ID	Deferred Bug Description
17363	WEB - HDCP status - In order to see the correct HDCP status, need to press "input" again (refresh).
17396	WEB - DHCP ON - There is no redirection, and the message is missing.
17401	WEB - UDP - There is no response from the device when UDP port of the device is defined differently than default, for example: 50003.

### Known Limitations (including compatibility limitations):

QC ID	Limitation Description
11103, 11107, 11108, 11119, 11122, 11124, 15177, 15194, 15207, 15235	LCD menu for input cards: HDCP menu "=1" means No HDCP reply back to source i.e. MAC mode active. At the same time, Protocol 3000 command HDCP-MOD? returns "ON".
14224	Matrix and Cards FWs downgrade is not supported

**Preceding Version:** 06.05.0000



**KRAMER ELECTRONICS, Ltd.**

E-mail: [info@kramerav.com](mailto:info@kramerav.com)

Web: [www.kramerav.com](http://www.kramerav.com)

## Release Notes History

**Product Name:** VS-6464DN-EM

**Current Version:**

Type	Number	Date
Firmware	06.05.0000	November 2021
Software	–	–
Web	–	–
Hardware	–	–

**RN Date:** November 7, 2021

**Reference:** 17825

### Kramer Product Affected:

Product Name	Minimum FW Version for Upgrade	Recommended for All Units	Only if Added Features are Required
VS-6464DN-EM	Any	Yes	Yes

### Summary:

- Fixed a bug.

### Codependency with Other Products and Software:

Product Name	Comments
Modules	See ACCESSORIES & RELATED PRODUCTS tab at <a href="http://www.kramerav.com/product/VS-6464DN-EM">www.kramerav.com/product/VS-6464DN-EM</a>



**KRAMER ELECTRONICS, Ltd.**

E-mail: [info@kramerav.com](mailto:info@kramerav.com)

Web: [www.kramerav.com](http://www.kramerav.com)

## Release Notes History

**Product Name:** VS-6464DN-EM

**Current Version:**

Type	Number	Date
Firmware	06.05.0000	November 2021
Software	–	–
Web	–	–
Hardware	–	–

**RN Date:** November 7, 2021

**Reference:** 17825

### Bugs Fixed:

QC ID	Fixed Bug Description
	Added support for UHDS-OUT2-F16 module card.

### Bugs to Fix in Future Versions:

QC ID	Deferred Bug Description
5216	OUT-LOAD menu: a circle is displayed at VGA Cards and SDI Cards outputs even though they are not connected to monitors.
11117	On F610-OUT4-F32 card P3K command HDCP-STAT? always returns "0". Should return Error.
12344	Configuring Default Setup via the front panel button requires two presses in order to proceed to Take button press.
12392	VS-6464DN-EM test card: Pattern generator Test card: Once after placing or removing jumper B19 for resolutions range extension, need also DIP switch toggle for B19 change to take effect.
14219	Rarely, Factory Default command may result in Keyboard operation freeze. Workaround: Power cycle the device.
16237	WEB - DGKat-OUT8-F64 - The LEDs are light green although the cable was disconnected from the card
16244	WEB - Copying an EDID (Input or Output) to All fails, Network Error is displayed, and the process is halted
16255	WEB - DGKAT OUT8 - F64 - EDID – Device must be rebooted in order to see the correct short summary of the EDID.
16263	WEB - DGKAT-OUT8-F64 - HDCP status is none although the source sends encrypted signal.
17126	WEB - The device copies corrupt edid - epon-eb-1000u_2_Blocks_Zeroes_In_Block_1
17363	WEB - HDCP status - In order to see the correct HDCP status, need to press "input" again (refresh).



**KRAMER ELECTRONICS, Ltd.**

E-mail: [info@kramerav.com](mailto:info@kramerav.com)

Web: [www.kramerav.com](http://www.kramerav.com)

## Release Notes History

QC ID	Deferred Bug Description
17396	WEB - DHCP ON - There is no redirection and the message is missing.
17401	WEB - UDP - There is no response from the device when UDP port of the device is defined differently than default,for example: 50003.

### Known Limitations (including compatibility limitations):

QC ID	Limitation Description
11103, 11107, 11108, 11119, 11122, 11124, 15177, 15194, 15207, 15235	LCD menu for input cards: HDCP menu "=1" means No HDCP reply back to source i.e. MAC mode active. At the same time, Protocol 3000 command HDCP-MOD? returns "ON".
14224	Matrix and Cards FWs downgrade is not supported

**Preceding Version:** Management / Keyboard: 6.3\_0003



**KRAMER ELECTRONICS, Ltd.**

E-mail: [info@kramerav.com](mailto:info@kramerav.com)

Web: [www.kramerav.com](http://www.kramerav.com)

## Release Notes History

**Product Name:** VS-6464DN-EM

**Current Version:**

Type	Number	Date
Firmware	Management / Keyboard: 6.3_0003	February 2021
	<b>Test Card: 3.1.0000</b>	<b>July 2018</b>
Software	–	–
Web	–	–
Hardware	–	–

**RN Date:** February 8, 2021

**Reference:** 16770

### Kramer Product Affected:

Product Name	Minimum FW Version for Upgrade	Recommended for All Units	Only if Added Features are Required
VS-6464DN-EM	Any	Yes	Yes

### Technical Notes:

- Fixed bugs.
- Added improvement.

### Codependency with Other Products and Software:

Product Name	Comments
Modules	See ACCESSORIES & RELATED PRODUCTS tab at <a href="http://www.kramerav.com/product/VS-6464DN-EM">www.kramerav.com/product/VS-6464DN-EM</a>



**KRAMER ELECTRONICS, Ltd.**

E-mail: [info@kramerav.com](mailto:info@kramerav.com)

Web: [www.kramerav.com](http://www.kramerav.com)

## Release Notes History

**Product Name:** VS-6464DN-EM

**Current Version:**

Type	Number	Date
Firmware	Management / Keyboard: 6.3_0003	February 2021
	<b>Test Card: 3.1.0000</b>	<b>July 2018</b>
Software	–	–
Web	–	–
Hardware	–	–

**RN Date:** February 8, 2021

**Reference:** 16770

### Modifications:

	Modification Description
	Improved switching speed.

### Bugs Fixed:

QC ID	Fixed Bug Description
11113	P3K command HDCP-STAT? now works properly.
14220	LCD screen FW version information view now provides Keyboard FW version.
14228	Protection layer added in case of accidental power down during FW upgrade procedure.
16136	Kramer Network Auto Scan and Support is available on TCP port 5000 and UDP 50000. Changing the TCP/UDP ports no longer limits Kramer Network management tool support.
16137	TCP and UDP Port number range was from 0 to 65534.
16143	WEB - "Start upgrade" button is now disabled after the first click and progress is now displayed.
16184, 17363	WEB – Correct HDCP status now shows.
16200	WEB - A name with an underscore at the beginning or end of a name is now accepted.
16239	WEB – VGAA-IN8-F64 – Resolution detect – "pixel" values are now updated correctly when changing resolution.
17057	WEB - Chassis: Webpage timeout was too short for Repower or Upgrade process.
17112	WEB – Fixed inconsistency between action response and terminal commands in bass/treble



**KRAMER ELECTRONICS, Ltd.**

E-mail: [info@kramerav.com](mailto:info@kramerav.com)

Web: [www.kramerav.com](http://www.kramerav.com)



## Release Notes History

QC ID	Fixed Bug Description
17368	WEB - EDID now copies to the input 33 (Test-IO module).
17369	WEB - EDID - Although the message appears - "Input X copy success", when pressing the SDI INPUT, the EDID does not copy.
17385	WEB - VGAA IN - The default of the Save timing and Recall Timing is correct.
17403	WEB - Settings - Configuration file can now be uploaded.
17426	WEB - Port information - Outputs – There is now correct response when clicking the out link.
17447	WEB - Upgrade - When a card is not upgradable and the upgrade stops, there is now a notification which slot is problematic.
17484	WEB - Microsoft EDGE browser - Upgrade works properly.
17486	WEB - IE 64 browser is now supported.

### Bugs to Fix in Future Versions:

QC ID	Deferred Bug Description
5216	OUT-LOAD menu: a circle is displayed at VGA Cards and SDI Cards outputs even though they are not connected to monitors.
11117	On F610-OUT4-F32 card P3K command HDCP-STAT? always returns "0". Should return Error.
12344	Configuring Default Setup via the front panel button requires two presses in order to proceed to Take button press.
12392	VS-6464DN-EM test card: Pattern generator Test card: Once after placing or removing jumper B19 for resolutions range extension, need also DIP switch toggle for B19 change to take effect.
14219	Rarely, Factory Default command may result in Keyboard operation freeze. Workaround: Power cycle the device.
16237	WEB - DGKat-OUT8-F64 - The LEDs are light green although the cable was disconnected from the card
16244	WEB - Copying an EDID (Input or Output) to All fails, Network Error is displayed, and the process is halted
16255	WEB - DGKAT OUT8 - F64 - EDID – Device must be rebooted in order to see the correct short summary of the EDID.
16263	WEB - DGKAT-OUT8-F64 - HDCP status is none although the source sends encrypted signal.
17126	WEB - The device copies corrupt edid - epon-eb-1000u_2_Blocks_Zeroes_In_Block_1
17363	WEB - HDCP status - In order to see the correct HDCP status, need to press "input" again (refresh).
17396	WEB - DHCP ON - There is no redirection and the message is missing.



**KRAMER ELECTRONICS, Ltd.**

E-mail: [info@kramerav.com](mailto:info@kramerav.com)

Web: [www.kramerav.com](http://www.kramerav.com)

## Release Notes History

QC ID	Deferred Bug Description
17401	WEB - UDP - There is no response from the device when UDP port of the device is defined differently than default, for example: 50003.

### Known Limitations (including compatibility limitations):

QC ID	Limitation Description
11103, 11107, 11108, 11119, 11122, 11124, 15177, 15194, 15207, 15235	LCD menu for input cards: HDCP menu "=1" means No HDCP reply back to source i.e. MAC mode active. At the same time, Protocol 3000 command HDCP-MOD? returns "ON".
14224	Matrix and Cards FWs downgrade is not supported

**Preceding Version:** Management / Keyboard: 6.2.0007



**KRAMER ELECTRONICS, Ltd.**

E-mail: [info@kramerav.com](mailto:info@kramerav.com)

Web: [www.kramerav.com](http://www.kramerav.com)

## Release Notes History

**Product Name:** VS-6464DN-EM

**Current Version:**

Type	Number	Date
Firmware	Management / Keyboard: 6.2.0007	August 2020
	<b>Test Card: 3.1.0000</b>	<b>July 2018</b>
Software	–	–
Web	–	–
Hardware	–	–

**RN Date:** September 23, 2020

**Reference:** 15342

### Kramer Product Affected:

Product Name	Minimum FW Version for Upgrade	Recommended for All Units	Only if Added Features are Required
VS-6464DN-EM	Any	Yes	Yes

### Technical Notes:

- Added new features and modifications.
- Fixed several bugs.

### Codependency with Other Products and Software:

Product Name	Comments
Modules	See ACCESSORIES & RELATED PRODUCTS tab at <a href="http://www.kramerav.com/product/VS-6464DN-EM">www.kramerav.com/product/VS-6464DN-EM</a>



**KRAMER ELECTRONICS, Ltd.**

E-mail: [info@kramerav.com](mailto:info@kramerav.com)

Web: [www.kramerav.com](http://www.kramerav.com)

## Release Notes History

**Product Name:** VS-6464DN-EM

**Current Version:**

Type	Number	Date
Firmware	Management / Keyboard: 6.2.0007	August 2020
	<b>Test Card: 3.1.0000</b>	<b>July 2018</b>
Software	–	–
Web	–	–
Hardware	–	–

**RN Date:** September 23, 2020

**Reference:** 15342

### New Features:

	New Feature Description
	Added embedded web pages via the Ethernet for chassis management, modular cards configuration and matrices multi-deployment.

### Modifications:

QC ID	Modification Description
	Updated metadata.json file.
	Updated the menu string for the front panel keyboard.

### Bugs Fixed:

QC ID	Fixed Bug Description
11129	P3K command HDCP-STAT? always returns "0", even if the connected screen supports HDCP.
11347	Protocol echoes are partly reported.
12316	K-Upload Application: Chassis control & management FW upgrade may result in "upload Error" message. Workaround: Retry upgrade until a successful upgrade is completed.
15077	Cards FW upgrade is not support through K-upload UDP connection. Use TCP connection only
15192	Keyboard menu setup may cause "No Return" reply on the LCD display. Workaround: Press "Back" and try again.
15211	Conf file does not include the EDID info about outputs.
15244	Changeable parameters are grayed out on Kramer Network.



**KRAMER ELECTRONICS, Ltd.**

E-mail: [info@kramerav.com](mailto:info@kramerav.com)

Web: [www.kramerav.com](http://www.kramerav.com)

## Release Notes History

### Bugs to Fix in Future Versions:

QC ID	Deferred Bug Description
5216	OUT-LOAD menu: a circle is displayed at VGA Cards and SDI Cards outputs even though they are not connected to monitors.
11113	P3K command HDCP-STAT? always returns "0". Even if the connected screen supports HDCP.
11117	On F610-OUT4-F32 card P3K command HDCP-STAT? always returns "0". Should return Error.
12344	Configuring Default Setup via the front panel button requires two presses in order to proceed to Take button press.
12392	VS-6464DN-EM test card: Pattern generator Test card: Once after placing or removing jumper B19 for resolutions range extension, need also DIP switch toggle for B19 change to take effect.
14219	Rarely, Factory Default command may result in Keyboard operation freeze. Workaround: Power cycle the device.
14220	LCD screen FW version information view provides Chassis FW version and Keyboard HW version. Keyboard FW version will be added in next release.
14228	Make sure not to power down the matrix during Chassis FW upgrade procedure.
16136	Kramer Network Auto Scan and Support is available on TCP port 5000 and UDP 50000. Changing the TCP/UDP ports limits Kramer Network management tool support.
16137	TCP and UDP Port number range is from 0 to 65534.
16143	WEB - "Start upgrade" button is not disabled after the first click and progress is not displayed.
16184	WEB - According to the webpage HDCP is ON, but on the monitor, the video is flickering and in the device the port is defined as HDCP OFF, Work Around: Clear cache.
16200	WEB - A name with an underscore at the beginning or end of a name is invalid, yet a message appears stating that the name was successfully saved.
16237	WEB - DGKat-OUT8-F64 - The LEDs are light green although the cable was disconnected from the card
16239	WEB - VGAA IN8 - F64 - Resolution detect - Some "pixel" values are not updated correctly when changing resolution.
16244	WEB - Copying an EDID (Input or Output) to All fails, Network Error is displayed, and the process is halted
16255	WEB - DGKAT OUT8 - F64 - EDID – Device must be rebooted in order to see the correct short summary of the EDID.
16259	WEB-VGAA-IN4-F32- The Resolution fields are not updated on when changing resolutions in Auto Detect mode.
16263	WEB - DGKAT-OUT8-F64 - HDCP status is none although the source sends encrypted signal.



## Release Notes History

QC ID	Deferred Bug Description
17057	Webpage timeout is too short for repower or upgrade procedure.
17057	Web - Chassis: Webpage timeout is too short for Repower or Upgrade process
17112	WEB - Inconsistency between action response and terminal commands in bass/treble
17126	WEB - The device copies corrupt edid - epon-eb-1000u_2_Blocks_Zeroes_In_Block_1
17363	WEB - HDCP status - In order to see the correct HDCP status, need to press "input" again (refresh).
17368	WEB - EDID fails to copy to the input 33 (test) – but a message appears: "In 33 copy success".
17369	WEB - EDID - Although the message appears - "Input X copy success", when pressing the SDI INPUT, the EDID does not copy.
17385	WEB - VGAA IN - The default of the Save timing and Recall Timing should be 1 or empty, actual 0
17396	WEB - DHCP ON - There is no redirection and the message is missing.
17401	WEB - UDP - There is no response from the device when UDP port of the device is defined differently than default, for example: 50003.
17403	WEB - Settings - There is no way to upload a configuration file
17426	WEB - Port information - Outputs – Occasionally, there is no response when clicking the out link.
17447	WEB - Upgrade - When a card is not upgradable and the upgrade stops, there is no notification which slot is problematic.
17484	WEB - Microsoft EDGE browser - Upgrade - An error appears when loading the FW file
17486	WEB - IE 64 browser is not supported.



## Release Notes History

### Known Limitations (including compatibility limitations):

QC ID	Limitation Description
11103, 11107, 11108, 11119, 11122, 11124, 15177, 15194, 15207, 15235	LCD menu for input cards: HDCP menu "=1" means No HDCP reply back to source i.e. MAC mode active. At the same time, Protocol 3000 command HDCP-MOD? returns "ON".
14224	Matrix and Cards FWs downgrade is not supported

**Preceding Version:** Management / Keyboard: 06.01.0009, Test Card: 3.1.0000



**KRAMER ELECTRONICS, Ltd.**

E-mail: [info@kramerav.com](mailto:info@kramerav.com)

Web: [www.kramerav.com](http://www.kramerav.com)

## Release Notes History

**Product Name:** VS-6464DN-EM

**Current Version:**

Type	Number	Date
Firmware	Management / Keyboard: 06.01.0009	March 2019
	Test Card: 3.1.0000	July 2018
Software	–	–
Web	–	–
Hardware	–	–

**RN Date:** March 2019

**Reference:** 14428

### Kramer Product Affected:

Product Name	Minimum FW Version for Upgrade	Recommended for All Units	Only if Added Features are Required
VS-6464DN-EM	Any	Yes	NA



This version can be applied ONLY to a unit running FW version 05.02.0000.

If you are running a lower version, please install the 05.02.0000 release before updating your device to 06.01.0009

### Technical Notes:

- Added new features.
- Fixed several bugs.



The Management and Keyboard firmware have been combined into one file.

### Codependency with Other Products and Software:

Product Name	Comments
Modules	See ACCESSORIES & RELATED PRODUCTS tab at <a href="http://www.kramerav.com/product/VS-6464DN-EM">www.kramerav.com/product/VS-6464DN-EM</a>



**KRAMER ELECTRONICS, Ltd.**

E-mail: [info@kramerav.com](mailto:info@kramerav.com)

Web: [www.kramerav.com](http://www.kramerav.com)



## Release Notes History

**Product Name:** VS-6464DN-EM

**Current Version:**

Type	Number	Date
Firmware	Management / Keyboard: 06.01.0009	March 2019
	Test Card: 3.1.0000	July 2018
Software	–	–
Web	–	–
Hardware	–	–

**RN Date:** March 2019

**Reference:** 14428

The following changes were made in this version:

### New Features:

	New Feature Description
	Modular Matrices are supported by Kramer Network 2.1 to include: Chassis and cards remote settings Chassis multi deployment
	Added Protocol 3000 IP remote commands: "#NET-CONFIG? 0" and "#NET-CONFIG 0,ip,mask,gate";

### Bugs Fixed:

QC ID	Fixed Bug Description
10759	Protocol Command echo for AUD-LVL is missing and to be added in next FW release.
11232	IR doesn't work with the tested control and KB versions.
11349	Test and Control card: IP reset test through commands FACTORY and RESET commands doesn't work.
12393	Missing FW version info for test card.
13689	EDID designer application cannot make use of the Internal Default EDID that is available in the matrix cards.
13699	P3K echo fixed to Support EDID designer. Broadcast "~01@display portID, 1" for "display connected". And broadcast "~01@display portID,2" for valid EDID



**KRAMER ELECTRONICS, Ltd.**

E-mail: [info@kramerav.com](mailto:info@kramerav.com)

Web: [www.kramerav.com](http://www.kramerav.com)

## Release Notes History

### Bugs to Fix in Future Versions:

QC ID	Deferred Bug Description
5216	OUT-LOAD menu: a circle is displayed at VGA Cards and SDI Cards outputs even though they are not connected to monitors.
11113	P3K command HDCP-STAT? always returns "0". Even if the connected screen supports HDCP.
11117	On F610-OUT4-F32 card P3K command HDCP-STAT? always returns "0". Should return Error.
11129	P3K command HDCP-STAT? always returns "0", even if the connected screen supports HDCP.
11347	Protocol echoes are partly reported.
12316	K-Upload Application: Chassis control & management FW upgrade may result in "upload Error" message. Workaround: Retry upgrade until a successful upgrade is completed.
12344	Configuring Default Setup via the front panel button requires two presses in order to proceed to Take button press.
12392	Pattern generator Test card: Once after placing or removing jumper B19 for resolutions range extension, need also DIP switch toggle for B19 change to take effect.
14219	Rarely, Factory Default command may result in Keyboard operation freeze. Workaround: Power cycle the device.
14220	LCD screen FW version information view provides Chassis FW version and Keyboard HW version. Keyboard FW version will be added in next release.
14228	Make sure not to power down the matrix during Chassis FW upgrade procedure.
15077	Cards FW upgrade is not support through K-upload UDP connection. Use TCP connection only
15192	Keyboard menu setup may cause "No Return" reply on the LCD display. Workaround: Press "Back" and try again.
15211	Conf file does not include the EDID info about outputs.
15244	Changeable parameters are grayed out on Kramer Network.

### Known Limitations (including compatibility limitations):

QC ID	Limitation Description
11103, 11107, 11108, 11119, 11122, 11124, 15177,	LCD menu for input cards: HDCP menu "=1" means No HDCP reply back to source i.e. MAC mode active. At the same time, Protocol 3000 command HDCP-MOD? returns "ON".



**KRAMER ELECTRONICS, Ltd.**

E-mail: [info@kramerav.com](mailto:info@kramerav.com)

Web: [www.kramerav.com](http://www.kramerav.com)

## Release Notes History

QC ID	Limitation Description
15194, 15207, 15235	
14224	Matrix and Cards FWs downgrade is not supported

**Preceding Version:**

Management: 05.04.0000\_0

Keyboard: 5.02.0001\_201

Test Card: 3.1.0000

**KRAMER ELECTRONICS, Ltd.**E-mail: [info@kramerav.com](mailto:info@kramerav.com)Web: [www.kramerav.com](http://www.kramerav.com)

## Release Notes History

**Product Name:** VS-6464DN-EM

**Current Version:**

Type	Number	Date
Firmware	Management: 05.04.0000_0 Keyboard: 5.02.0001_201 Test Card: 3.1.0000	July 2018
Software	–	–
Web	–	–
Hardware	–	–

**RN Date:** July 2018

**Reference:** 14323

### Kramer Product Affected:

Product Name	Minimum FW Version for Upgrade	Recommended for All Units	Only if Added Features are Required
VS-6464DN-EM	Any	Yes	Yes

### Technical Notes:

- This firmware upgrade fixes a critical issue in Management firmware 5.02.0000 - sometimes after power cycling the MAC address of the matrix is reset to AA-BB-CC-DD-EE-FF
- This firmware upgrade includes two changes in the chassis frame:
  - Management FW: 05.04.0000\_0 – update using K-Upload app
  - Keyboard FW: 5.02.0001\_201 – update using K-Upload app

### Codependency with Other Products and Software:

- There is no codependency with other products or software.



**KRAMER ELECTRONICS, Ltd.**

E-mail: [info@kramerav.com](mailto:info@kramerav.com)

Web: [www.kramerav.com](http://www.kramerav.com)

## Release Notes History

**Product Name:** VS-6464DN-EM

**Current Version:**

Type	Number	Date
Firmware	Management / Keyboard: 06.01.0009	March 2019
	Test Card: 3.1.0000	July 2018
Software	–	–
Web	–	–
Hardware	–	–

**RN Date:** March 2019

**Reference:** 14428

The following changes were made in these two FW versions:

### Bugs Fixed:

QC ID	Fixed Bug Description
14174	Using Management firmware 5.02.0000 sometimes after power cycling the MAC address of the matrix is reset to AA-BB-CC-DD-EE-FF (fixed by Management FW upgrade)
14196	Following Management firmware 5.02.0000 update the Front panel IP MENU show a MAC address that does not match the actual product MAC (fixed by Keyboard FW upgrade)

### Bugs to Fix in Future Versions:

QC ID	Deferred Bug Description
11347	Protocol echoes are partly reported.
12316	K-Upload Application: Chassis control & management FW upgrade may result in "upload Error" message. <b>Workaround:</b> Retry upgrade until a successful upgrade is completed.
12344	Configuring "Default Setup" through the front panel button requires two presses in order to proceed to 'Take' button press
12392	Pattern generator Test card: Rarely, after placing or removing jumper B19 for resolutions range extension, you also need to perform a DIP switch toggle for the B19 change to take effect.
13689	EDID designer application cannot make use of the Internal Default EDID that is available in the matrix cards.
	EDID Designer application: No support for default EDID.



**KRAMER ELECTRONICS, Ltd.**

E-mail: [info@kramerav.com](mailto:info@kramerav.com)

Web: [www.kramerav.com](http://www.kramerav.com)

## Release Notes History

### Known Limitations (including compatibility limitations):

QC ID	Limitation Description
	None listed

**Preceding Version: F - Management: 5.02.0000, Keyboard App: 5.01.0000, Test Card: 3.1.0000**



**KRAMER ELECTRONICS, Ltd.**

E-mail: [info@kramerav.com](mailto:info@kramerav.com)

Web: [www.kramerav.com](http://www.kramerav.com)

## Release Notes History

**Product Name:** VS-6464DN-EM

**Current Version:**

Type	Number	Date
<b>Firmware</b>	Management: 5.02.0000 Keyboard App: 5.01.0000 Test Card: 3.1.0000	May 2018
<b>Software</b>	–	–
<b>Web</b>	–	–
<b>Hardware</b>	–	–

**RN Date:** May 2018

**Reference:** 13941

### Kramer Product Affected:

Product Name	Minimum FW Version for Upgrade	Recommended for All Units	Only if Added Features are Required
VS-6464DN-EM	Any	Yes	N/A

### Technical Notes:

- Added several new features.
- Fixed several bugs.

### Codependency with Other Products and Software:

Product Name	Comments
Modules	See ACCESSORIES & RELATED PRODUCTS tab at <a href="https://www.kramerav.com/il/product/VS-6464DN-EM">https://www.kramerav.com/il/product/VS-6464DN-EM</a>



**KRAMER ELECTRONICS, Ltd.**

E-mail: [info@kramerav.com](mailto:info@kramerav.com)

Web: [www.kramerav.com](http://www.kramerav.com)

## Release Notes History

**Product Name:** VS-6464DN-EM

**Current Version:**

Type	Number	Date
<b>Firmware</b>	Management: 5.02.0000 Keyboard App: 5.01.0000 Test Card: 3.1.0000	May 2018
<b>Software</b>	–	–
<b>Web</b>	–	–
<b>Hardware</b>	–	–

**RN Date:** May 2018

**Reference:** 13941

The following changes were made in this version:

### New Features:

	New Feature Description
	Support for KPTW file upgrade (Using K-Upload and Kramer Network apps)
	Added support for EDID Designer application. And add support for EDID management using Kramer Network
	Added HW-TEMP Protocol 3000 command for temperature read from supporting cards.
	Added network info on LCD. (IP, IP Mask, IP gateway and DHCP on/off status)

### Bugs Fixed:

QC ID	Fixed Bug Description
11232, 12467	IR remote control is not supported
12229, 12405, 12406	K-Upload application: A successful chassis control & management fw upgrade may result with Error message 006. Though the upgrade process is completed successfully with no issues
12391	Protocol echo is not reporting Keyboard Lock operation
12393	Protocol commands MODULE-VER and MODUL-INFO sometimes return wrong '00.00.0000' instead of the actual burnt FW version.
12458	Keyboard command ALL-OFF does not function.

### Bugs to Fix in Future Versions:

QC ID	Deferred Bug Description
11347	Protocol echoes are partly reported.



**KRAMER ELECTRONICS, Ltd.**

E-mail: [info@kramerav.com](mailto:info@kramerav.com)

Web: [www.kramerav.com](http://www.kramerav.com)



## Release Notes History

QC ID	Deferred Bug Description
12316	K-Upload Application: Chassis control & management FW upgrade may result in "upload Error" message. <b>Workaround:</b> Retry upgrade until a successful upgrade is completed.
12344	Configuring "Default Setup" through the front panel button requires two presses in order to proceed to 'Take' button press.
12392	Pattern generator Test card: Rarely, after placing or removing jumper B19 for resolutions range extension, you also need to perform a DIP switch toggle for the B19 change to take effect.
13689	EDID designer application cannot make use of the Internal Default EDID that is available in the matrix cards.
	EDID Designer application: No support for default EDID.

### Known Limitations (including compatibility limitations):

QC ID	Limitation Description
	None listed.

**Preceding Versions:** F – Management: 5.0.0013, Keyboard App: 5.0.0001, Test Card: 3.01.0000



**KRAMER ELECTRONICS, Ltd.**

E-mail: [info@kramerav.com](mailto:info@kramerav.com)

Web: [www.kramerav.com](http://www.kramerav.com)

## Release Notes History

**Product Name:** VS-6464DN-EM

**Current Version:**

Type	Number	Date
<b>Firmware</b>	Management: 5.0.0013 Keyboard App: 5.0.0001 Test Card: 3.01.0000	March 2018
<b>Software</b>	–	–
<b>Web</b>	–	–
<b>Hardware</b>	–	–

**RN Date:** March 2018

**Reference:** 11432

### Kramer Product Affected:

Product Name	Minimum FW Version for Upgrade	Recommended for All Units	Only if Added Features are Required
VS-6464DN-EM	N/A	N/A	N/A

### Technical Notes:

- This is a release note for a new product.

### Codependency with Other Products and Software:

Product Name	Comments
Modules	See ACCESSORIES & RELATED PRODUCTS tab at <a href="https://www.kramerav.com/il/product/VS-6464DN-EM">https://www.kramerav.com/il/product/VS-6464DN-EM</a> .

### Replaced Products:

Product Name	Comments
VS-6464DN	



**KRAMER ELECTRONICS, Ltd.**

E-mail: [info@kramerav.com](mailto:info@kramerav.com)

Web: [www.kramerav.com](http://www.kramerav.com)

## Release Notes History

**Product Name:** VS-6464DN-EM

**Current Version:**

Type	Number	Date
Firmware	3.01	March 2018
Software	–	–
Web	–	–
Hardware	–	–

**RN Date:** March 2018

**Reference:** 11432

This is a release note for a new product. For a list of new product features see:

[www.kramerav.com/manual/VS-6464DN-EM](http://www.kramerav.com/manual/VS-6464DN-EM)

### Bugs to Fix in Future Versions:

QC ID	Deferred Bug Description
Chassis	
11232	Chassis: IR doesn't work with the tested control and KB versions.
12239	Chassis: Missing P3K control for audio parameters of VGAA-IN8-F64 card.
Test Card	
11416	Test Card: THD+N, input saturation and output saturation issue.
11418	Test Card: Signal to Noise vs Frequency is non-weighted in non-saturated volume level.
12229	Test Card: FW upgrade may fail. In case of failure, retry.
12392	Test card: Removal of jumper B19 recognized only after second power-up.
11462	Test Card: Interoperability issue with VM-10H2.
Keyboard	
12344	Keyboard: Need to press the Default Setup button twice instead of once.
12457	Keyboard: ALL OFF operation does not function.
DGKat-IN/OUT8-F64	
5580	DGKat-IN8-F64: Does not support HDCP ON/OFF feature.
5582	DGKat-IN/OUT8-F64: Unit does not manipulate the deep color to 8 bits in the EDID file.
5591	DGKat-IN8-F64: WUXGA does not show up in Default EDID as supported resolution.
VGAA-IN/OUT8-F64	
11149	VGAA-IN8-F64: Default EDID model name appears inaccurately.
11307	VGAA-IN/OUT8-F64: Switching speed is identical for all 3 options.
11313	VGAA-IN/OUT8-F64: Analog to analog Full scale issue.
11415	VGAA + Test Card: Analog to analog Full scale issue.



**KRAMER ELECTRONICS, Ltd.**

E-mail: [info@kramerav.com](mailto:info@kramerav.com)

Web: [www.kramerav.com](http://www.kramerav.com)

## Release Notes History

QC ID	Deferred Bug Description
12316	VGAA-IN8-F64: FW upgrade through K-upload may fail. In case of failure, retry.
HDCP-IN/OUT8-F64	
11647	HDCP-IN8-F64: One minute delay when showing signal from 840HXL.

### Known Limitations (including compatibility limitations):

QC ID	Limitation Description
	None listed.

**Preceding Version:** N/A



**KRAMER ELECTRONICS, Ltd.**

E-mail: [info@kramerav.com](mailto:info@kramerav.com)

Web: [www.kramerav.com](http://www.kramerav.com)