

## Release Notes

**Product Name:** VS-66H2, VS-48H2, VS-84H2

**Current Version:**

Type	Number	Date
Firmware	1.2_0000 1.1.2	July 2020
Software	—	—
Web	—	—
Hardware	—	—

**RN Date:** July 19, 2020

**Reference:** 07598

### Kramer Product Affected:

Product Name	Minimum FW Version for Upgrade	Recommended for All Units	Only if Added Features are Required
VS-66H2	N/A	N/A	N/A
VS-48H2	N/A	N/A	N/A
VS-84H2	N/A	N/A	N/A

### Technical Notes:

- This is a release note for a new products.

### Codependency with Other Products and Software:

- There is no codependency with other products or software.



**KRAMER ELECTRONICS, Ltd.**

E-mail: [info@kramerav.com](mailto:info@kramerav.com)

Web: [www.kramerav.com](http://www.kramerav.com)

## Release Notes

**Product Name:** VS-66H2, VS-48H2, VS-84H2

**Current Version:**

Type	Number	Date
Firmware	1.2_0000 1.1.2	July 2020
Software	–	–
Web	–	–
Hardware	–	–

**RN Date:** July 19, 2020

**Reference:** 07598

This is a release note for a new products. For a list of new product features see:

[www.kramerav.com/manual/VS-66H2](http://www.kramerav.com/manual/VS-66H2)

[www.kramerav.com/manual/VS-48H2](http://www.kramerav.com/manual/VS-48H2)

[www.kramerav.com/manual/VS-84H2](http://www.kramerav.com/manual/VS-84H2)

### Bugs to Fix in Future Versions:

QC ID	Deferred Bug Description
15437	Auto Switching may occur unexpectedly following EDID copy operation.
16276	Timeout setting for 5V_off is not available when video is lost on the input. However, when the input cable is disconnected, 5V_off works properly.
17276	Web Login – When activating 'Authentication' you need to define a new password (default is empty string).
17941	Output with Audio Only ON doesn't stop 5V output when video and audio inputs are removed.
17253	When UDP port is changed from the default of 50000 Kramer Network is not able to automatically discover the device.
17272	Web UI browsing is recommended using Chrome, Safari or Firefox. Browsing through IE11 64 may fail.
17572	Web UI IP address change requires page refresh following IP address update.
17626	VS-84H2 only – ARC outputs 1-8 can be routed to inputs through the web pages. ARC routing is possible through front panel buttons only for outputs 1-4 towards any of the inputs.
17601	NAME P3K command execution through TCP port results in connection closure.
17926	Web UI – On "Switching" page Video Mute icon checkbox does not toggle back to Video Unmute.



**KRAMER ELECTRONICS, Ltd.**

E-mail: [info@kramerav.com](mailto:info@kramerav.com)

Web: [www.kramerav.com](http://www.kramerav.com)

## Release Notes

QC ID	Deferred Bug Description
17927	Web UI - On "Timeout settings" page "Support Audio Only" switch does not function.
18034	VS-84H2 only – EDID-copy operation to INPUTS 5-8 results in video loss on the INPUT although the EDID-copy operation is successfully completed. Workaround: Power cycle VS-84H2.

### Known Limitations (including compatibility limitations):

QC ID	Limitation Description
	None listed

**Preceding Version:** N/A



**KRAMER ELECTRONICS, Ltd.**

E-mail: [info@kramerav.com](mailto:info@kramerav.com)

Web: [www.kramerav.com](http://www.kramerav.com)