



Release Note

Product Name: VP-732

Current Version:

Ver.Type	Ver No.	Date
Firmware	Master_VTF1.27 OSD_VTM1.10 Slave_1.04	July 2017
Software	_	_
Web	-	_
Hardware	-	_

RN Date: July 2017

Reference: 12232

Kramer Product Affected:

Product Name	Minimum FW Version for Upgrade	Recommended for All Units	Only if Added Features are Required
VP-732	Any	Yes	N/A

Technical Notes:

- Added last connected input feature.
- Added new P3K commands: FACTORY, HELP, MODEL?, PROT-VER?, RESET, VERSION?, ETH-PORT, ETH-PORT?, NET-DHCP, NET-DHCP?, NET-GATE, NET-GATE?, NET-IP, NET-IP?, NET-MAC?, NET-MASK, NET-MASK?, ROUTE, ROUTE?, AUD-LVL, AUD-LVL?, MUTE, MUTE?, VFRZ, VFRZ?, SIGNAL?, VMUTE, VMUTE?, VIEW-MOD, VIEW-MOD?,
- Modifications made to password entry, security mode, and 4K output VIC.

Codependency with Other Products and Software:

• There is no codependency with other products or software.



KRAMER ELECTRONICS, Ltd.





Release Note

Product Name: VP-732

Current Version:

Ver.Type	Ver No.	Date
Firmware	Master_VTF1.27 OSD_VTM1.10 Slave_1.04	July 2017
Software	_	_
Web	_	_
Hardware	_	_

RN Date: July 2017

Reference: 12232

The following changes were made in this version:

New Features:

	New Feature Description
	Output automatically switches to last connected HDMI input

Modifications:

QC ID	Modification Description	
	Several details of password entry and security mode operation have been modified	
6889	Modified 4K output VIC	
	Added P3K volume commands	

Bugs Fixed:

QC ID	Fixed Bug Description	
5777	After factory reset, password resets to default and security status turns off	
6901	Removed "1" from several path names	
	Fixed controller error when working with Kramer RC-74DL	
	Fixed downscaling issue when working with VP-510 Downconverter	
6881	Changed VGA EDID serial number to 1	
7130	Solved Ethernet communication issue	
7363	Fixed USB compatibility issue	
	Fixed FW download issue	
	Fixed compatibility issue with PT-571 & PT-572+	



KRAMER ELECTRONICS, Ltd.





Release Note

Bugs to Fix in Future Versions:

QC ID	Deferred Bug Description	
3303	Issue with HDCP on DP input	
3304	No output on DP for some output resolutions	
5315	No signal detection on input when connected to DGKat source	
6182	Using DP as the PIP source, powering up a DVD on the HDMI input may produce a green screen	
	Miscellaneous web GUI issues for PIP operation	
7098	After DHCP was set to On the devices get stuck for about 20 seconds	
7130	Sometimes webpage gets stuck and a power cycle is needed to reload.	
7211	Labels with long names not displayed correctly in webpages	
7212	Fine-Tune via WEB: Sometimes when changing the H-Position and V-Position quickly, the action is not performed	
7226	Password prompt appears when 'Activate Security' is off	
7229	Factory Reset cannot be performed via WEB	
7348	Text Overlay 3.0: Logo Enable option doesn't work	
8629	IP address and gateway can be set with the same values	
10857	Handshake command is not supported	
10859	Wrong answer when sending incorrect Ethernet command	
11170	Blank and Freeze buttons on web may require more than one button press	
11268	Input switching priority list not available via the webpages	
11622	HDCP input is muted in PIP mode in HDCP Follow Input mode	
10854	The last static IP is displayed as the IP of the device when Dynamic IP is On	
11163	Webpage: Internet Explorer 32,64 Pages are corrupted, and problematic with browsers in Tablet and Laptop Devices.	
11183	After power cycling following a Custom Logo download from USB, there is no audio on the HDMI1 Output	
11279	The Unit Name is not reset after Factory Reset from WEB ,OSD, and protocol commands	
11280	Ethernet and Serial Protocol commands sometimes stop responding	
7185	Sometimes, volume slider values on the webpages are not updated when the volume is changed via OSD	
3330	ETH LEDs - no activity indication	
3735	DP output only works in HDCP mode	

Preceding Version: F: NP – 1.0



KRAMER ELECTRONICS, Ltd.





Release Note History

Product Name:	VP-732		
Current Version:	NP – 1.0		
Version Date:	May 2015		
Reference:	4511		
Release Type:			
Firmware	Software	☐ Hardware	
Kuaman Duadust Af	factori.		

Kramer Product Affected:

Product Name	Minimum FW Version for Upgrade	Recommended for All Units	Only if Added Features are Required
VP-732	N/A	N/A	N/A

Technical Notes:

• This is a release note for a new product.

Codependency with Other Products and Software:

There is no codependency with other products or software.

Known Issues:

There are no known issues.



KRAMER ELECTRONICS, Ltd.